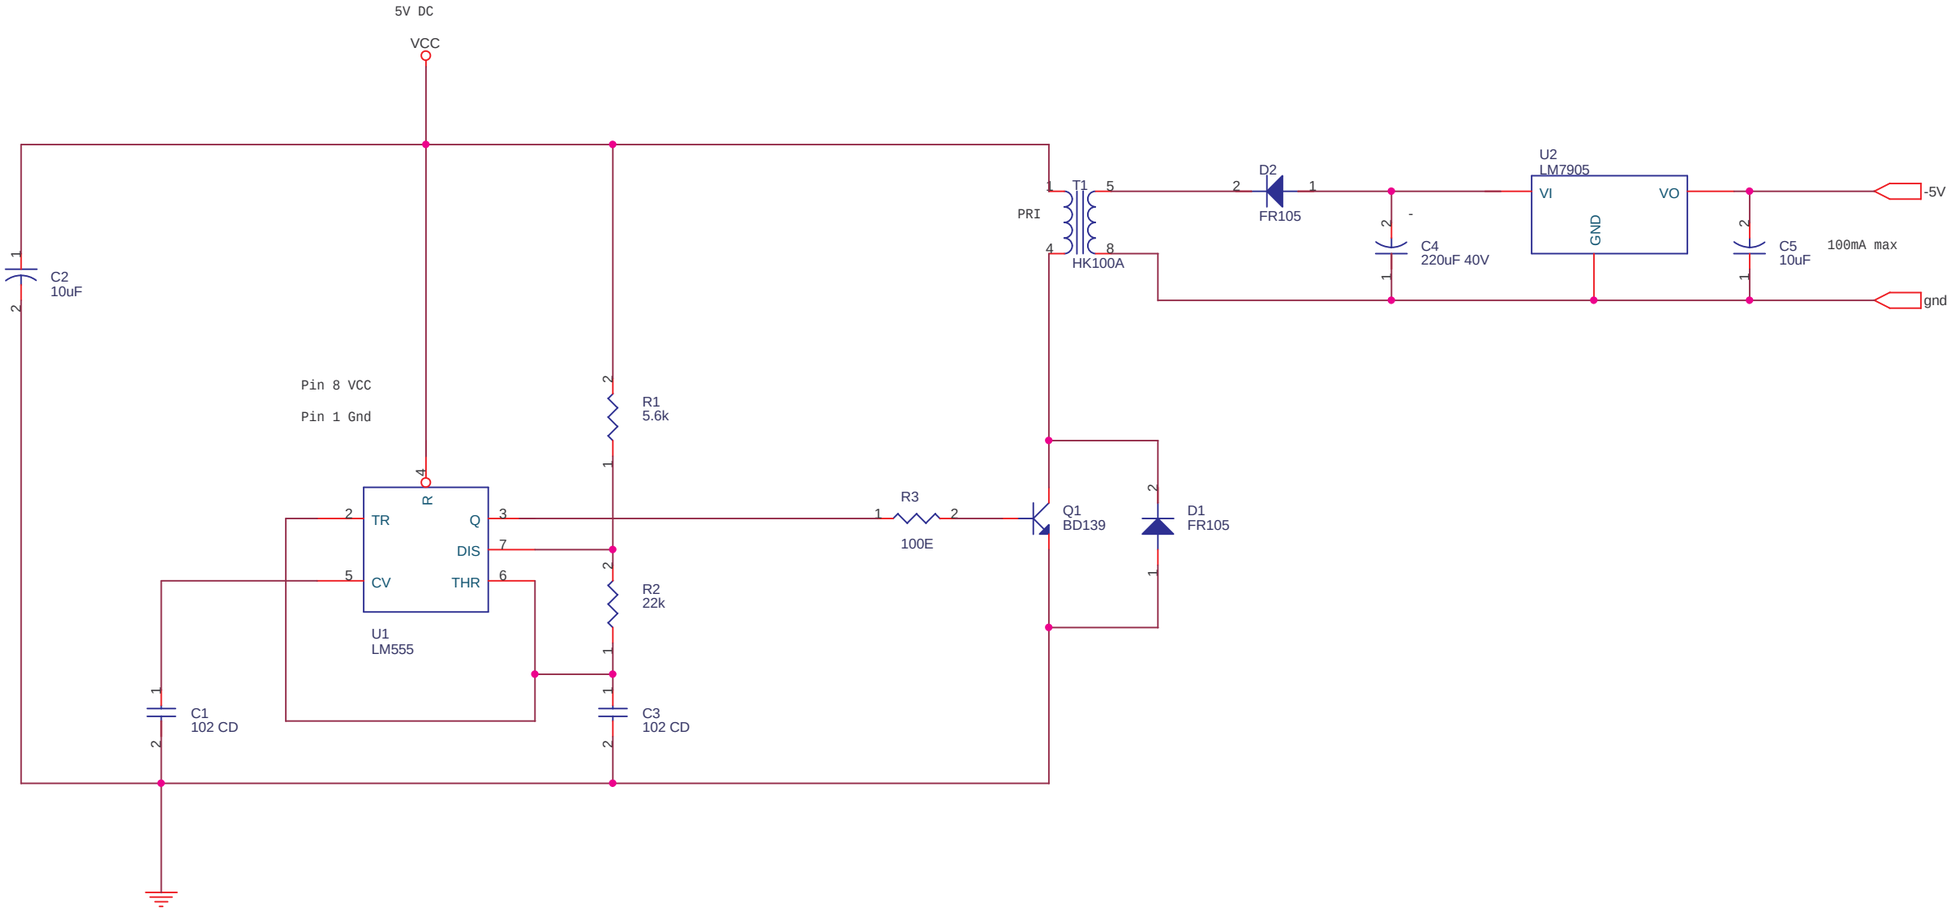



T1

Transformer

Pri 40 turns 36 swg
Sec 90 turns 36 swg

wind pri first
Insulation tape between pri and sec
wind sec next
cover final sec with tape

Pot core HK100 OL
18mm dia 10mm ht

Use a pot core clamp
or nylon nut bolt
to fix to pcb

Dact Elektrotech

Phone 6768863
2590, 17th Cross, 8th Main
Banashankari 2nd Stage
Bangalore 560070

Title
-5V from +5V Power Suppy

Size	Document Number	Rev
B	DACT0020.SCH	00

Date: Monday, August 11, 2003 Sheet 1 of 1